

Tê a 90°


Tee 90°

Té à 90°

Te 90°



01 10 1004 000

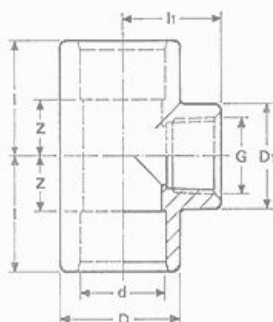

d	G	D	D1	I	I1	Z	Gr	Quant	Nº Código
20	"1/2	26	30	27	27	11	25	B 70	01 10 1004 004
25	"1/2	33	30	33	28	14	41	B 50	01 10 1004 005
25	"3/4	33	37	33	33	14	49	B 40	01 10 1004 006
32	"1/2	42	30	39	35	17	70	B 30	01 10 1004 050
32	"3/4	42	37	39	37	17	76	B 30	01 10 1004 051
32	1 "	42	45	38	38	17	85	B 30	01 10 1004 007
40	"1/2	49	30	47	41	21	95	B 25	01 10 1004 055
40	"3/4	49	37	47	43	21	100	B 25	01 10 1004 056
40	1 "	49	45	47	45	21	110	B 25	01 10 1004 057
40	1" 1/4	49	53	47	48	21	117	B 20	01 10 1004 008
50	"1/2	60	30	57	50	26	155	B 14	01 10 1004 060
50	"3/4	60	37	57	52	26	160	B 14	01 10 1004 061
50	1 "	60	45	57	54	26	170	B 14	01 10 1004 062
50	1" 1/4	60	53	57	57	26	175	B 14	01 10 1004 063

Tê a 90°


Tee 90°

Té à 90°

Te 90°



01 10 1004 000

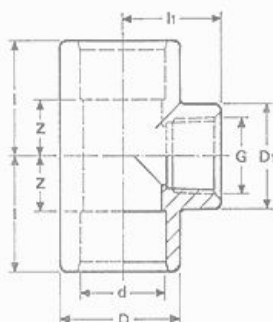

(suite)

d	G	D	D1	I	I1	Z	Gr	Quant	N° Código
50	1" 1/2	60	64	57	57	26	206	B 12	01 10 1004 009
63	"1/2	76	30	72	61	44	303	B 8	01 10 1004 065
63	"3/4	76	37	72	63	44	310	B 8	01 10 1004 066
63	1"	76	45	72	65	44	320	B 8	01 10 1004 067
63	1" 1/4	76	53	72	68	44	325	B 8	01 10 1004 068
63	1" 1/2	76	64	72	68	44	350	B 8	01 10 1004 010
63	2 "	76	76	72	72	44	380	B 8	01 10 1004 011
75	1" 1/2	92	65	84	75	40	564	B 3	01 10 1004 012
75	2" 1/2	88,5	88,5	82	82	38	510	B 3	01 10 1004 030
90	1" 1/2	110	65	99	84	48	865	C 8	01 10 1004 013
90	3 "	105	105	97	97	46	780	C 9	01 10 1004 040
110	1 " 1/2	132	65	119	86	58	1432	C 5	01 10 1004 014
110	2 "	132	76	119	86	58	1440	C 5	01 10 1004 015
110	2" ½	132	92	119	102	58	1480	C 5	01 10 1004 016

Tê a 90°


Tee 90°

Té à 90°

Te 90°



01 10 1004 000

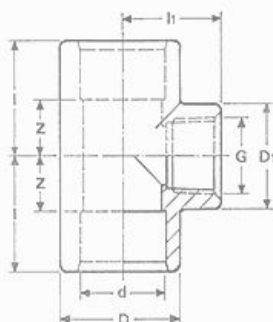

(suite)

d	G	D	D1	I	I1	Z	Gr	Quant	Nº Código
110	3 "	132	110	119	109	58	1603	c 4	01 10 1004 017
110	4 "	132	132	119	119	58	1640	c 4	01 10 1004 018