

Junções


Unions

Manchons union

Enlaces 3 piezas



40 90 8093 000

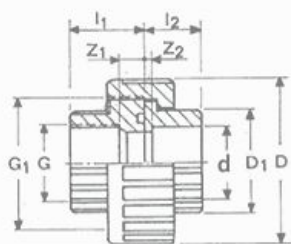

G	d	G1	D	D1	l1	l2	Z1	Z2	Gr	Quant	Nº Código
1/2	20	40x10	46	28	26	20	10	3	31.5	B 60	02 10 2114 055
" 3/4	25	47x10	56	36	28	23	10	3	55	B 40	02 10 2114 056
1"	32	53x8	67	42	30	26	10	3	79	B 20	02 10 2114 057
1" 1/4	40	66x8	82	52	41	31	13	3	129	C 60	02 10 2114 058
1" 1/2	50	74x8	88	63	45	35	14	3	160	C 45	02 10 2114 059
2"	63	90x8	106	77	52	42	14	3	259	C 30	02 10 2114 060

Junções


Unions

Manchons union

Enlaces 3 piezas



40 90 8093 000

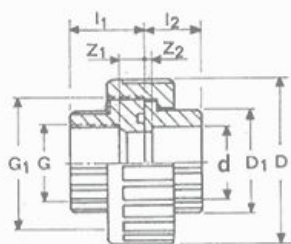

Union nuts

d	G	I	D	Gr	Quant	Nº Código
20	40x10	22	46	12		02 01 2118 012
25	47x10	26	56	23		02 01 2118 034
32	53x8	28	67	36		02 01 2118 100
40	66x8	30	82	52		02 01 2118 114
50	74x8	31	88	56		02 01 2118 150
63	90x8	38	106	94		02 01 2118 200

Junções


Unions

Manchons union

Enlaces 3 piezas



40 90 8093 000

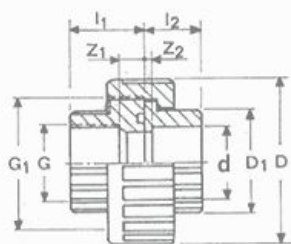

Union ends

d	A	D	I	Z	Gr	Quant	Nº Código
20	36	28	20	3	7		02 05 2116 020
25	43	36	23	3	13		02 05 2116 025
32	50	42	26	3	17		02 05 2116 032
40	63	52	31	3	28		02 05 2116 040
50	69	63	35	10	38		02 05 2116 050
63	83	77	42	14	63		02 05 2116 063

Junções


Unions

Manchons union

Enlaces 3 piezas



40 90 8093 000

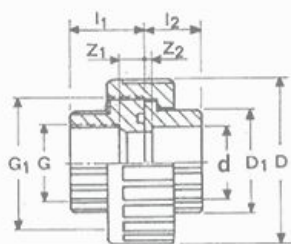

Union bushes

G	G1	I	Z	E	F	H	D	Gr	Quant	Nº Código
"1/2	40x10	26	10	28.4	4.3	2.5	28	12		02 01 2117 012
" 3/4	47x10	28	10	35.5	4.8	2.5	36	18		02 01 2117 034
1 "	53x8	30	10	39.6	4.6	2.5	42	25		02 01 2117 100
1" 1/4	66x8	41	13	51.8	7	4	52	46		02 01 2117 114
1" 1/2	74x8	45	22	57	7	4	63	68		02 01 2117 150
2 "	90x8	52	18	70	7	4	77	113		02 01 2117 200

Junções


Unions

Manchons union

Enlaces 3 piezas



40 90 8093 000

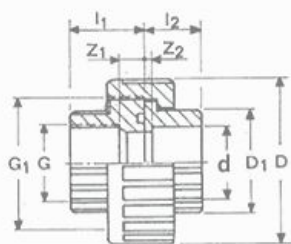

«O» ring gaskets

D	d	l	Gr	Quant	Nº Código
28.86	21.80	3.53			40 90 8093 011
35.23	28.17	3.53			40 90 8093 014
38.36	31.30	3.53			40 90 8093 015
51.30	40.64	5.33			40 90 8093 018
57.65	46.99	5.33			40 90 8093 024
70.36	59.70	5.33			40 90 8093 030