

Junções


Unions

Manchons union

Enlaces 3 piezas



40 90 8093 000

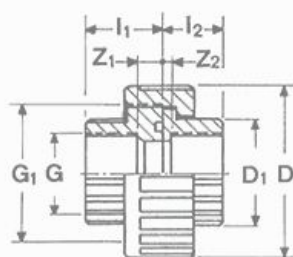

G	G1	I1	I2	Z1	Z2	D	D1	Gr	Quant	Nº Código
"1/2	40x10	26	20	10	3	46	28	32	B 60	02 01 2114 012
" 3/4	47x10	28	23	10	3	56	36	54	B 40	02 01 2114 034
1 "	53x8	30	26	10	3	67	42	76	B 20	02 01 2114 100
1" 1/4	66x8	41	31	13	3	82	52	129	C 60	02 01 2114 114
1" 1/2	74x8	45	35	22	10	88	63	175	C 45	02 01 2114 150
2 "	90x8	52	42	18	14	106	77	259	C 30	02 01 2114 200

Junções


Unions

Manchons union

Enlaces 3 piezas



40 90 8093 000

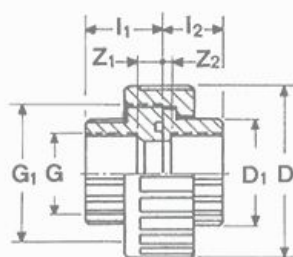

Union nuts

d	G	l	D	Gr	Quant	Nº Código
20	40x10	22	46	12		02 01 2118 012
25	47x10	26	56	23		02 01 2118 034
32	53x8	28	67	36		02 01 2118 100
40	66x8	30	82	52		02 01 2118 114
50	74x8	31	88	56		02 01 2118 150
63	90x8	38	106	94		02 01 2118 200

Junções


Unions

Manchons union

Enlaces 3 piezas



40 90 8093 000

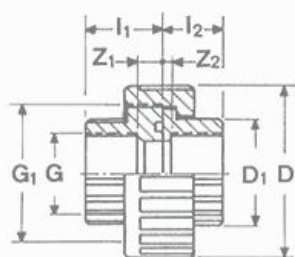

Union ends

G	I	A	D	Z	Gr	Quant	Nº Código
"1/2	20	36	28	3	7		02 01 2116 012
" 3/4	23	43	36	3	12		02 01 2116 034
1 "	26	50	42	3	17		02 01 2116 100
1" 1/4	31	63	52	3	28		02 01 2116 114
1" 1/2	35	69	63	10	45		02 01 2116 150
2 "	42	83	77	14	76		02 01 2116 200

Junções


Unions

Manchons union

Enlaces 3 piezas



40 90 8093 000

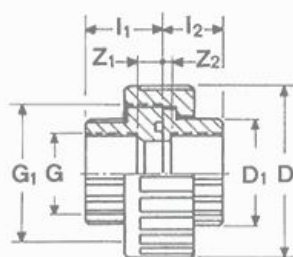

Union bushes

G	G1	I	Z	E	F	H	D	Gr	Quant	Nº Código
"1/2	40x10	26	10	28.4	4.3	2.5	28	12		02 01 2117 012
" 3/4	47x10	28	10	35.5	4.8	2.5	36	18		02 01 2117 034
1 "	53x8	30	10	39.6	4.6	2.5	42	25		02 01 2117 100
1" 1/4	66x8	41	13	51.8	7	4	52	46		02 01 2117 114
1" 1/2	74x8	45	22	57	7	4	63	68		02 01 2117 150
2 "	90x8	52	18	70	7	4	77	113		02 01 2117 200

Junções


Unions

Manchons union

Enlaces 3 piezas



40 90 8093 000

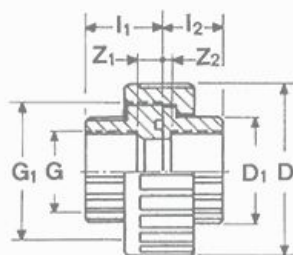

«O» ring gaskets

D	d	l	Gr	Quant	Nº Código
28.86	21.80	3.53			40 90 8093 011
35.23	28.17	3.53			40 90 8093 014
38.36	31.30	3.53			40 90 8093 015
51.30	40.64	5.33			40 90 8093 018
57.65	46.99	5.33			40 90 8093 024
70.36	59.70	5.33			40 90 8093 030