

Tês com saída roscada fêmea


Female union tees 90°

Tés à 90° femelle

Tes 90° hembra



20 41 2004 000

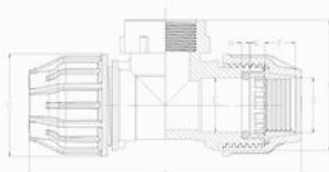

d	d1	A	B	C	D	E	F	G	H	Gr	Quant	Nº Código
16	" 1/2	110	46	39	17	17	12	12	3	67		20 41 2004 003
16	" 3/4	112	46	39	17	17	12	12	3	65		20 41 2004 004
20	" 1/2	132	54	46	22	21	12	7	3.5	103		20 41 2004 005
20	" 3/4	132	54	46	22	21	12	7	3.5	101		20 41 2004 006
25	" 1/2	139	57	52	27	26	13	10	4	111		20 41 2004 009
25	" 3/4	139	57	52	27	26	13	10	4	126		20 41 2004 010
25	1"	142	60	52	27	26	13	10	4	131		20 41 2004 011
32	" 3/4	169	66	64	34	33	19	12	5	203	100	20 41 2004 014
32	1"	169	66	64	34	33	19	12	5	198	100	20 41 2004 015
40	1" 1/4	209	98	78	41	42	23	13	6	380	45	20 41 2004 020
40	1" 1/2	209	100	78	41	42	23	13	6	387	45	20 41 2004 021
50	1" 1/2	235	113	92	51	52	31	13	6.5	551	30	20 41 2004 025
50	2"	235	113	92	51	52	31	13	6.5	536	30	20 41 2004 026
63	2"	281	121	109	64	66	39	22	7	920	18	20 41 2004 030

Tês com saída roscada fêmea


Female union tees 90°

Tés à 90° femelle

Tes 90° hembra



20 41 2004 000

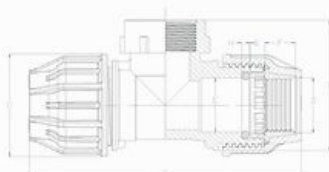

(continued)

d	d1	A	B	C	D	E	F	G	H	Gr	Quant	Nº Código
63	2" 1/2	281	141	109	64	65	39	22	7	960	18	20 41 2004 031
75	2"	321	171	132	76	78	40	23	8	1384	10	20 41 2004 059
75	2" 1/2	321	173	132	76	78	40	23	8	1330	10	20 41 2004 060
75	3"	321	174	132	76	78	40	23	8	1470	10	20 41 2004 061
90	3"	402	200	151	94	92	57	31	8	2221	7	20 41 2004 065
110	4"	565	230	175	112	113	57	36	9	3730	4	20 41 2004 070